




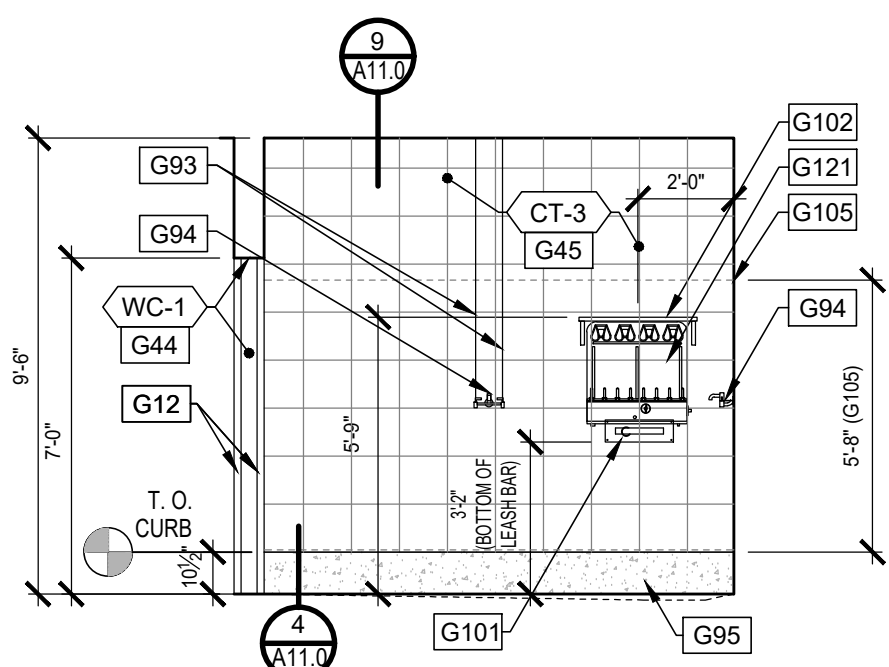


16 BATHING AREA (116)
A8.2 SCALE: 1/4" = 1'-0"

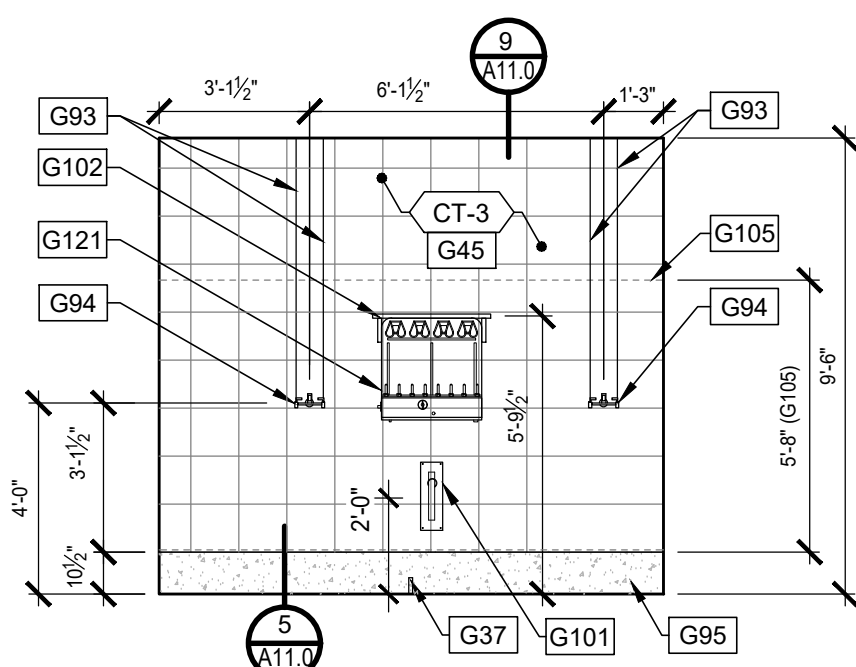


15 BATHING AREA (116)
A8.2 SCALE: 1/4" = 1'-0"

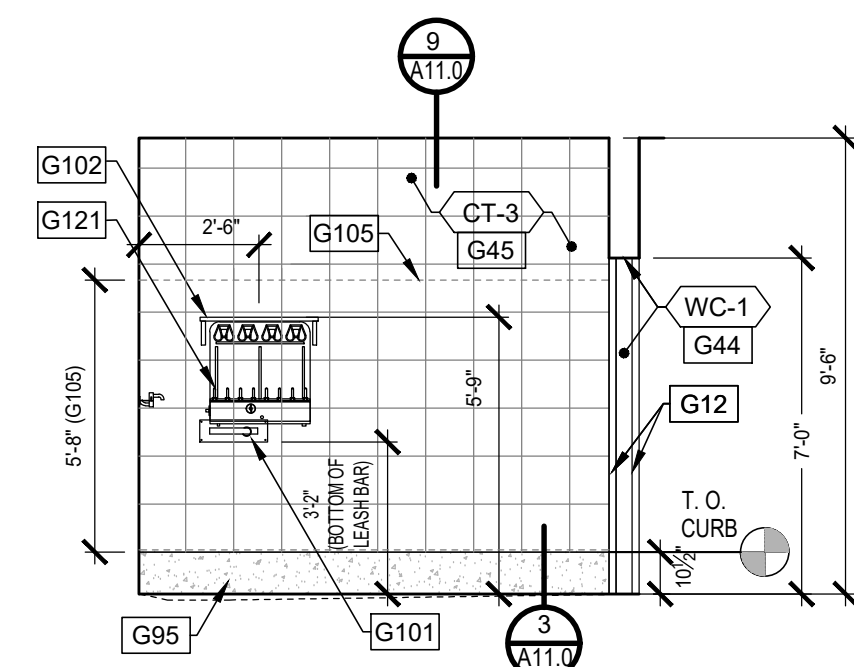


14 BATHING AREA (116)
A8.2 SCALE: 1/4" = 1'-0"

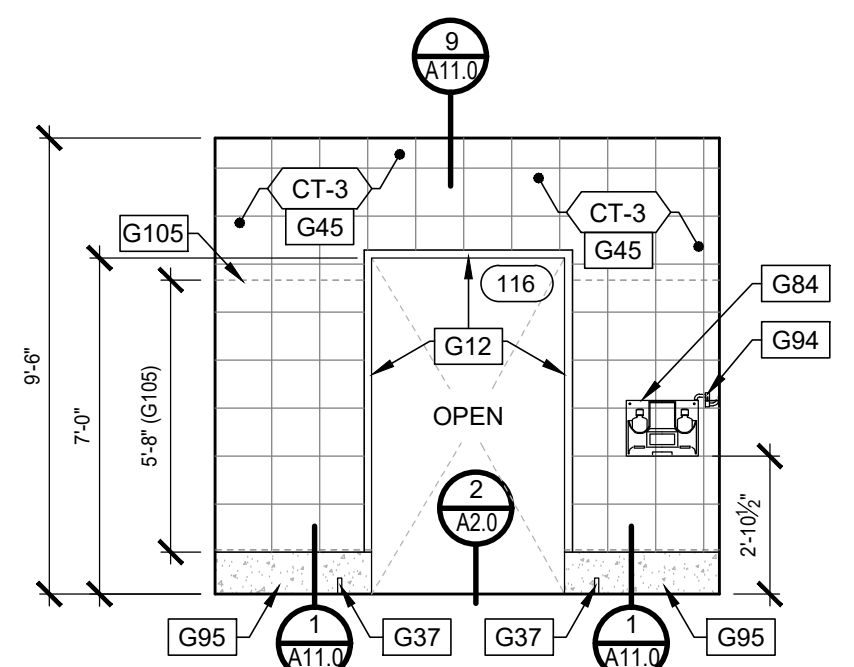


13 BATHING AREA (116)
A8.2 SCALE: 1/4" = 1'-0"

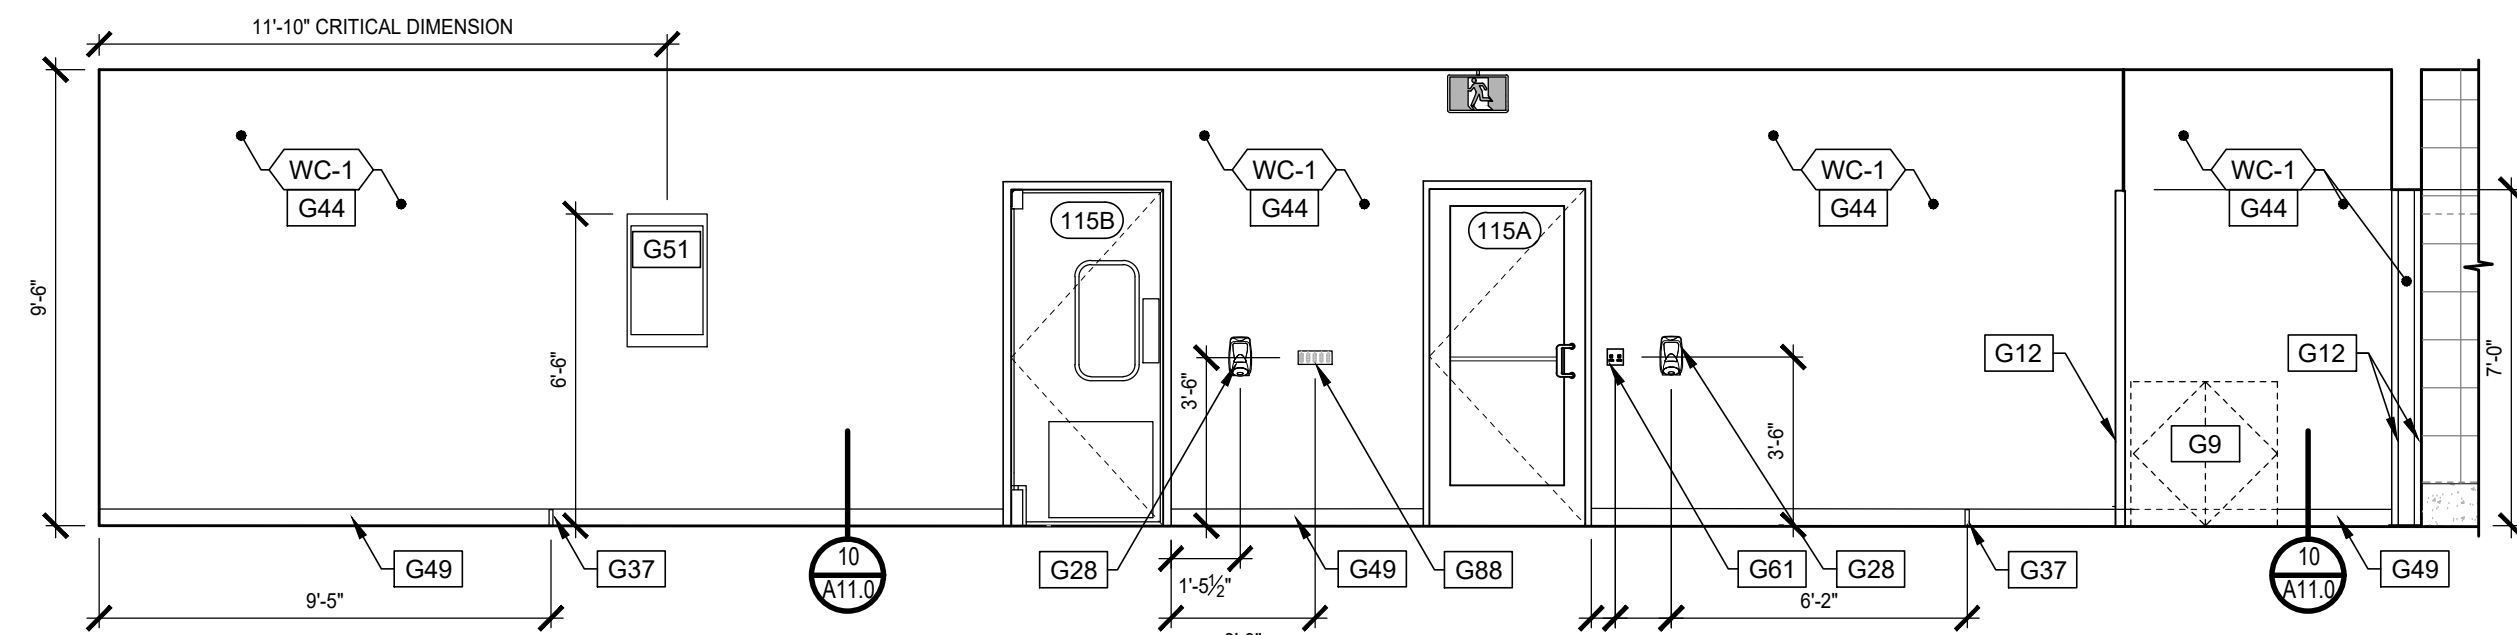


12 DRYING AREA (115)
A8.2 SCALE: 1/4" = 1'-0"

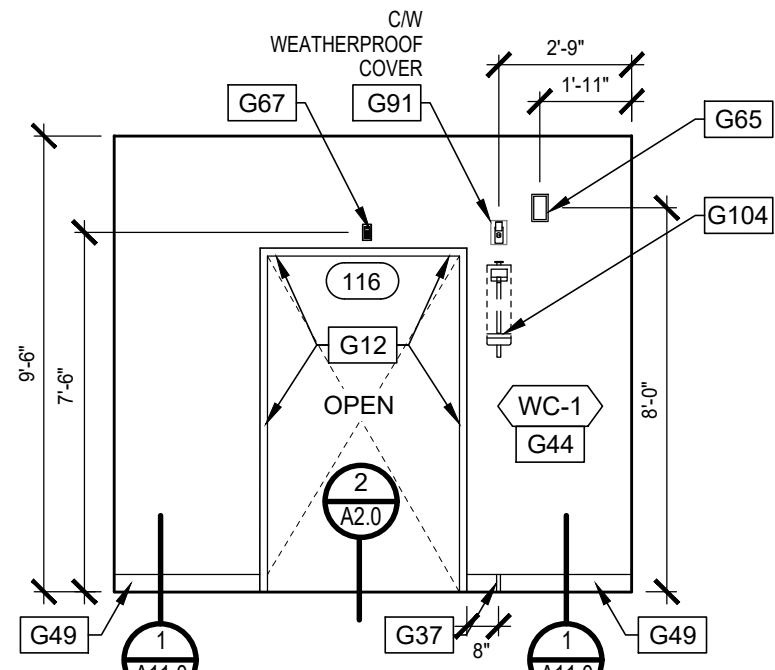


11 DRYING AREA (115)
A8.2 SCALE: 1/4" = 1'-0"

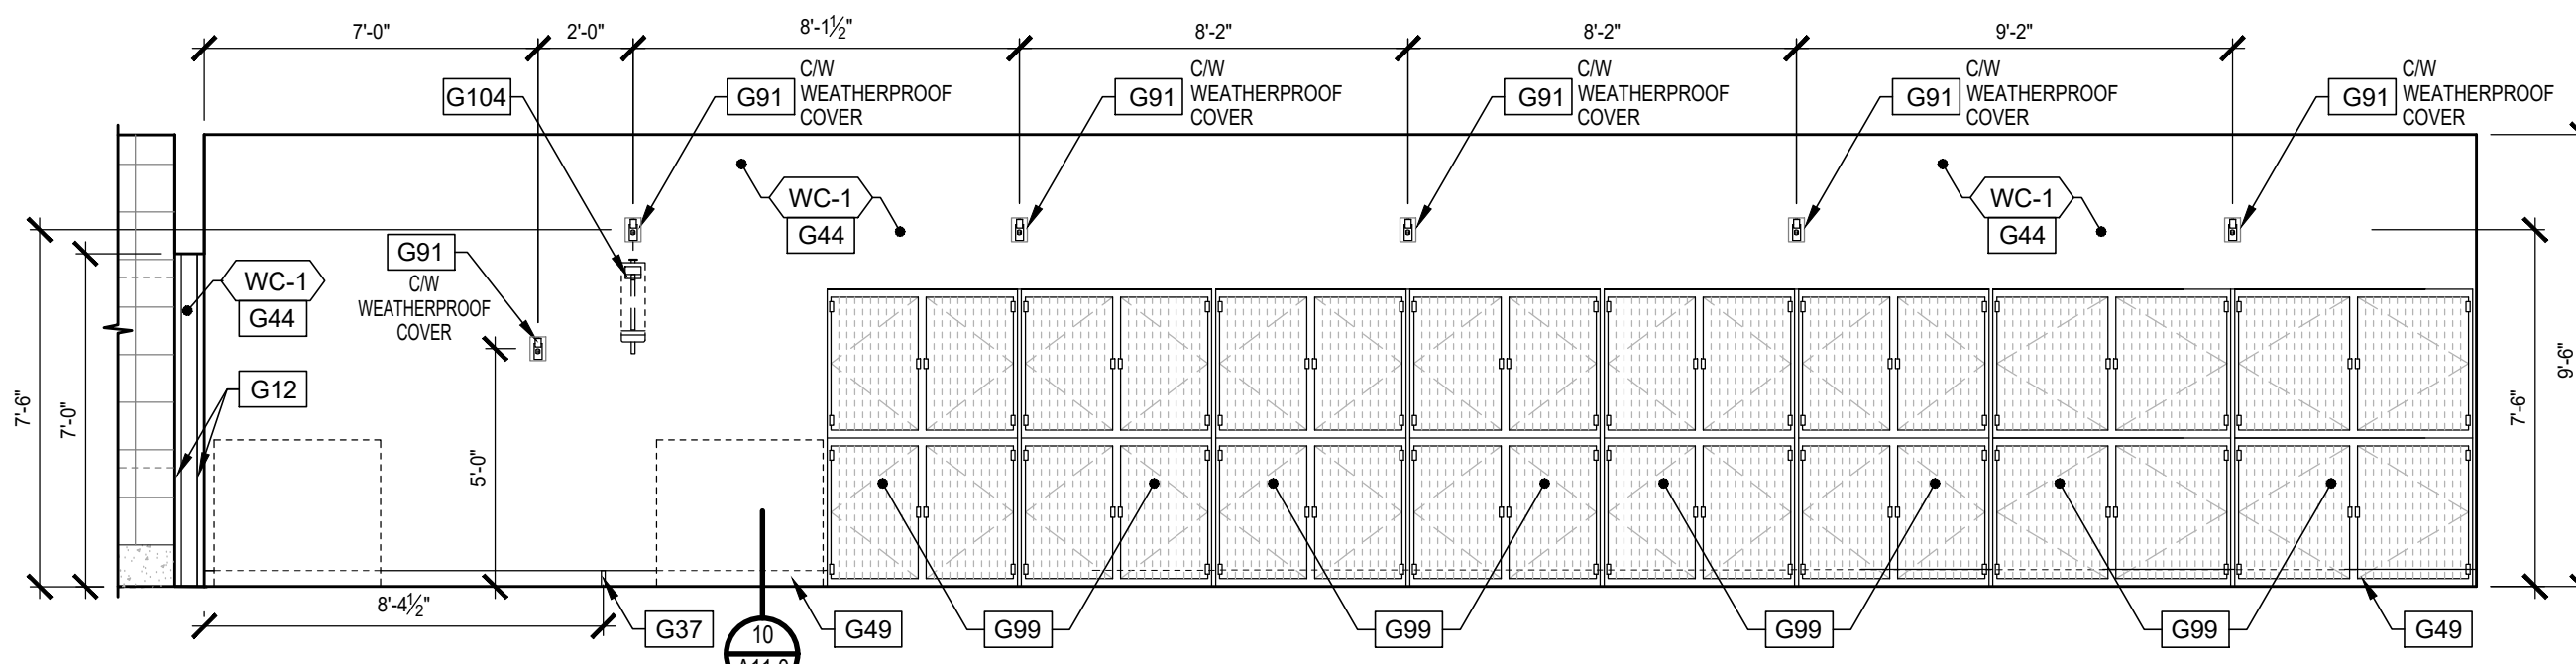


10 DRYING AREA (115)
A8.2 SCALE: 1/4" = 1'-0"

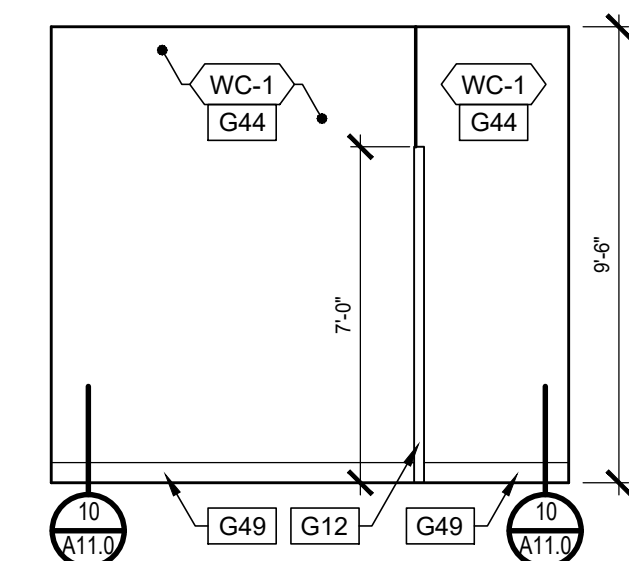


9 DRYING AREA (115)
A8.2 SCALE: 1/4" = 1'-0"

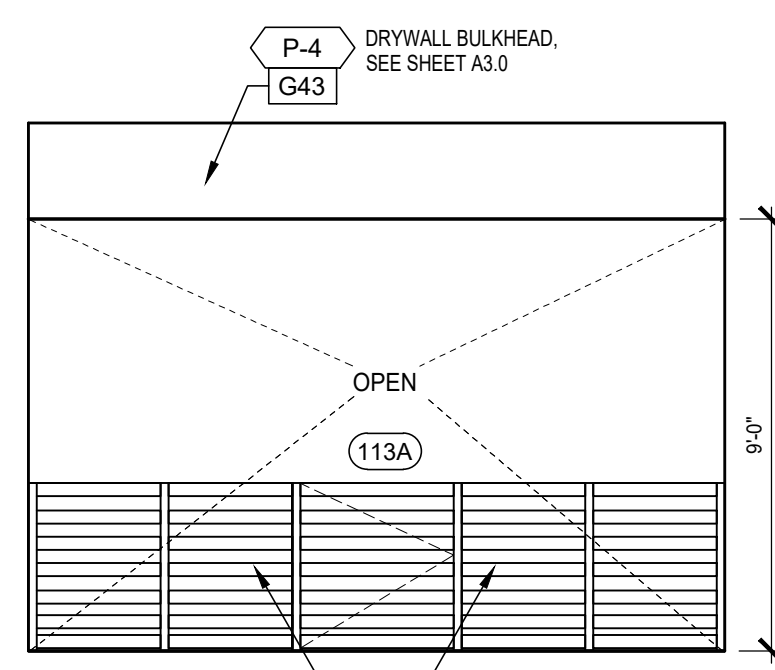


8 SALON CHECK-IN (113)
A8.2 SCALE: 1/4" = 1'-0"

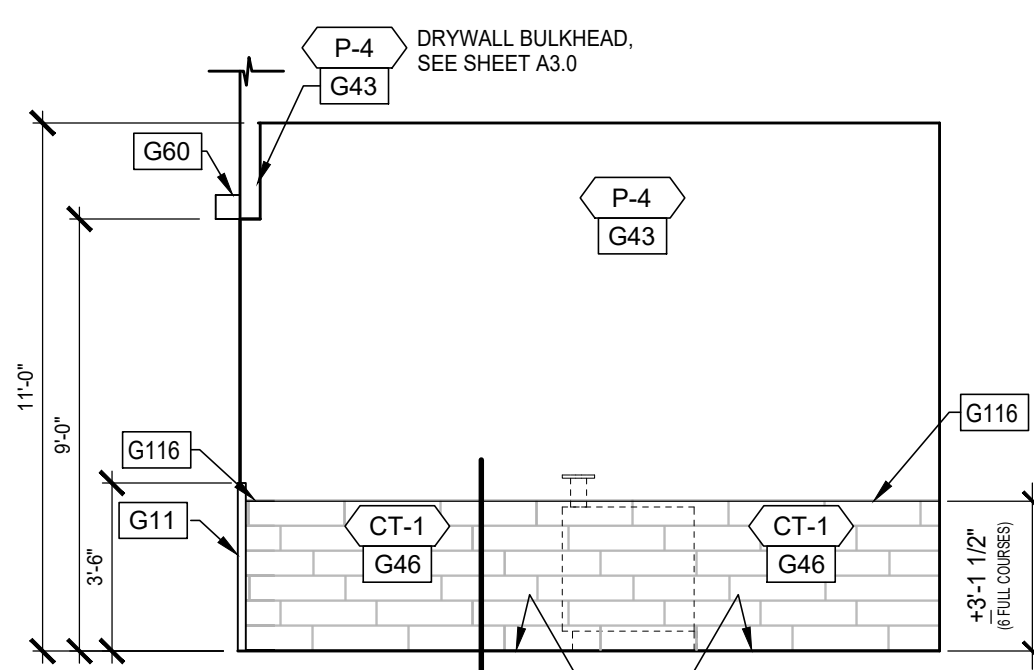


7 SALON CHECK-IN (113)
A8.2 SCALE: 1/4" = 1'-0"

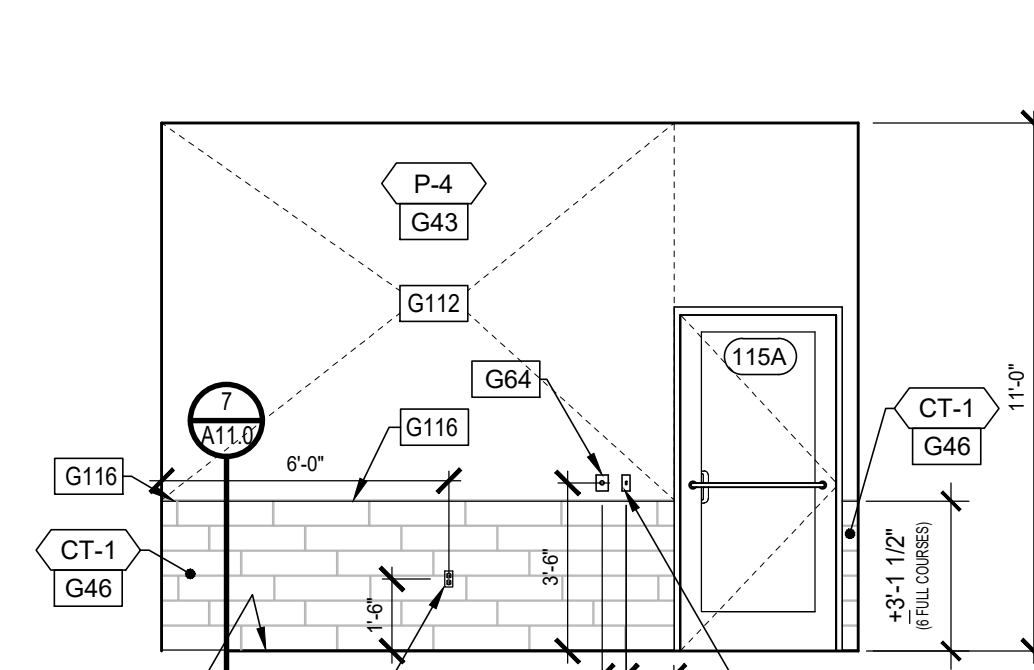


6 SALON CHECK-IN (113)
A8.2 SCALE: 1/4" = 1'-0"

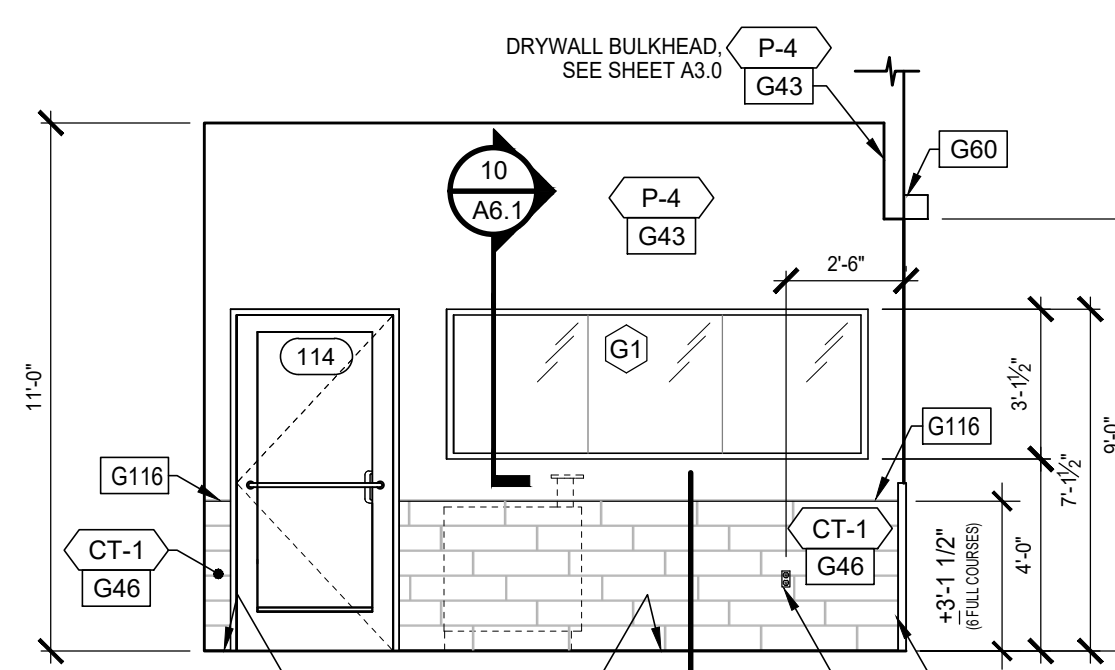


5 SALON CHECK-IN (113)
A8.2 SCALE: 1/4" = 1'-0"

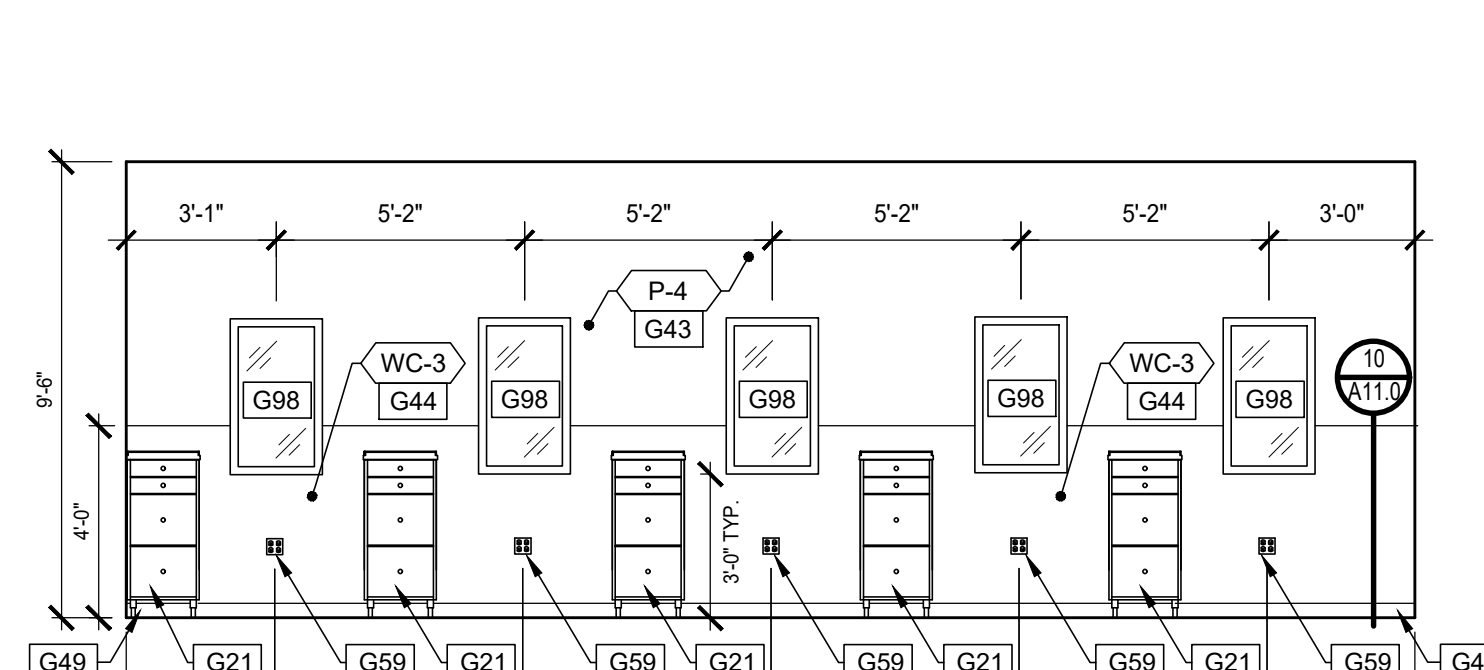


4 SALON (114)
A8.2 SCALE: 1/4" = 1'-0"

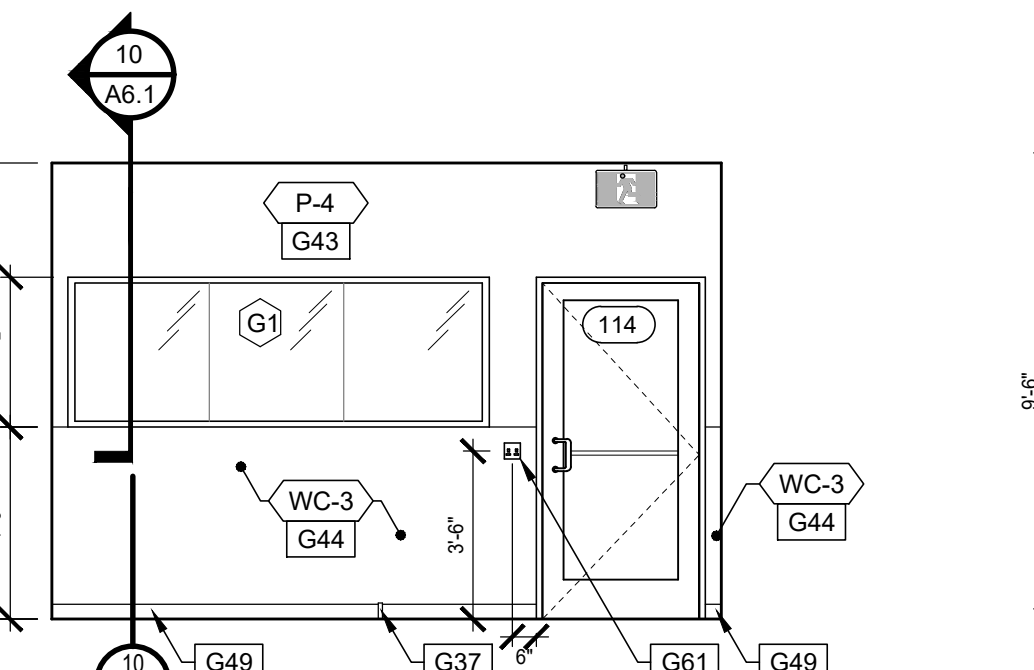

3 SALON (114)
A8.2 SCALE: 1/4" = 1'-0"

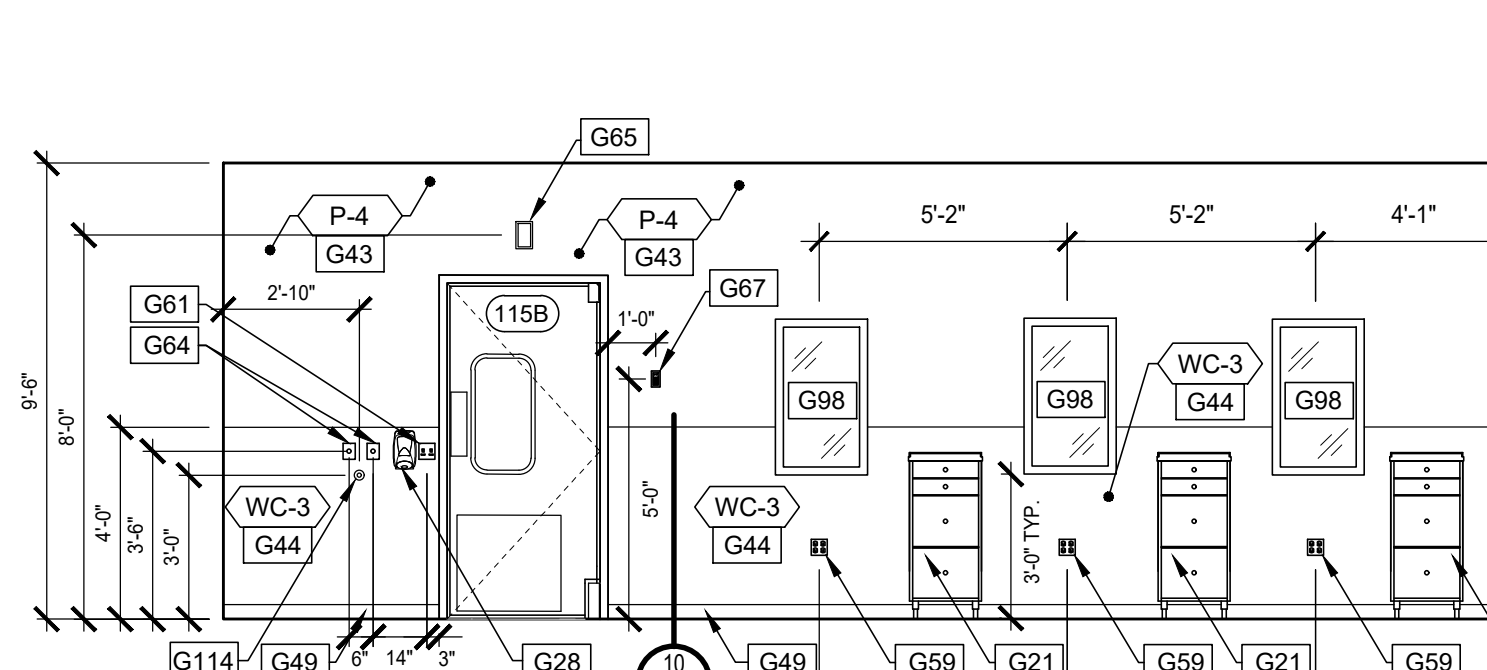

2 SALON (114)
A8.2 SCALE: 1/4" = 1'-0"

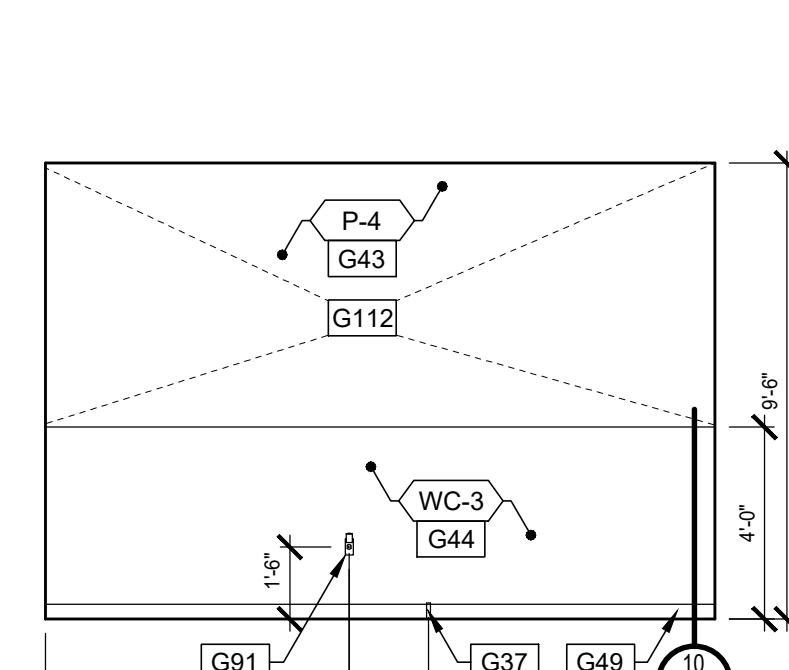

1 SALON (114)
A8.2 SCALE: 1/4" = 1'-0"

GENERAL NOTES:

- SEE SHEET A0.1 FOR ARCHITECTURAL KEY NOTES.

FRP GENERAL NOTES:

- MILLWORK VENDOR HIRED BY G.C. SHALL PROVIDE AND INSTALL FRP SYTEM. IT IS THE G.C. RESPONSIBILITY TO INCLUDE THEIR PRICE IN HIS BID.
- THERE WILL BE NO EXCEPTIONS. THE AREAS THAT RECEIVE THE FRP MUST BE PROPERLY PREPPED. IF THE AREAS ARE NOT CLEAN, PROPERLY PREPARED AND PROPERLY LIGHTED CAUSING A DELAY IN INSTALLATION, THE GC WILL BE REQUIRED TO PAY MILLWORK VENDOR FOR EACH DAY LONGER THAT THE INSTALL TAKES AS WELL AS THE COST TO PREPARE THE AREAS CORRECTLY. THE COST FOR DELAY WILL BE PAID DIRECTLY TO MILLWORK VENDOR.
- GENERAL CONTRACTORS SHALL BE RESPONSIBLE FOR PROVIDING MATERIAL TAKE-OFF FOR ORDERING OF THE FRP, TRIM AND BASE (MILLWORK VENDOR TO SUPPLY AND INSTALL).
- TYPICAL LEAD TIME FOR FRP MATERIALS IS TO BE COORDINATED WITH MILLWORK VENDOR.

TILE INSTALLATION CRITERIA

- EXPPOSED OR SHARP EDGES ARE NOT PERMITTED. FACTORY FINISHED EDGES (NOT FIELD CUT EDGES) MAY BE EXPOSED ONLY WHERE INDICATED IN THE DRAWINGS.
- THE LAYOUT OF THE TILE WAINSCOT, SHOWN ON THE INTERIOR ELEVATIONS, IS TO BE LAID OUT SUCH THAT THE FIELD IS EQUAL, CENTERED, FROM END OF THE WALL TO THE OPPOSITE END UNLESS NOTED OTHERWISE. THERE WILL TYPICALLY BE CUT TILES ON BOTH ENDS AND THERE SHALL NEVER BE LESS THAN 1/2 OF ONE TILE USED IN THE FIELD OF THE WAINSCOT, UNLESS SPECIFIED START POINT OR ROOM CONFIGURATION DICTATES TILE TO BE LESS THAN 1/2 OF ONE TILE.
- IN ALL ROOMS WITH FLOOR TILE AND MATCHING WALL TILE WAINSCOT AND TILE BASE, THE JOINTS OF THE FLOOR AND WALL TILES ARE TO ALIGN.

MISCELLANEOUS BLOCKING SCHEDULE:

ROOM NAME	ROOM NUMBER	BLOCKING FOR	MATERIAL
VESTIBULE	100	WALL BUMPER GUARDS (SEE DETAIL 14/A12.0)	8" METAL STRAP (SEE DETAIL 14/A12.0)
		CRASH RAIL (SEE DETAIL 14/A12.0)	12" METAL STRAP (SEE DETAIL 14/A12.0)
SALES AREA	101	WALL BUMPER GUARDS (SEE DETAIL 14/A12.0)	8" METAL STRAP (SEE DETAIL 14/A12.0)
		DECOR LEDGES (SEE DETAIL 14/A12.0)	3/4" X 24" PLYWOOD
FRONT P.O.S.	102	DECOR LEDGE	3/4" X 24" PLYWOOD
BOPS CLOSET	103	DOOR STOP	6005162-33 MTL. STUD
MANAGER/VAULT	104	DOOR STOP	6005162-33 MTL. STUD
		PAPER TOWEL DISPENSER	3/4" PLYWOOD
ASSOCIATES RESOURCES	106	HAND SANITIZER DOOR STOP	3/4" PLYWOOD
HALL A	108	WALL BUMPER GUARDS (SEE DETAIL 14/A12.0)	8" METAL STRAP (SEE DETAIL 14/A12.0)
		DINING FOUNTAINS	2X6
		S.S. SHELF	3/4" PLYWOOD
UNISEX WASHROOM	110	GRAB BARS TOILET PAPER DISPENSER TOWEL DISPENSER SANITARY WIPING DISPAL HAND SANITIZER TOILET SEAT COVER DISPENSER MIRROR BABY CHANGING SHELF CLOTHES HOOK DOOR STOP S.S. SHELF	3/4" PLYWOOD 2 X 6 3/4" PLYWOOD 3/4" PLYWOOD
UNIVERSAL WASHROOM	111	GRAB BARS TOILET PAPER DISPENSER TOWEL DISPENSER HAND SANITIZER TOILET SEAT COVER DISPENSER MIRROR BABY CHANGING SHELF CLOTHES HOOK DOOR STOP S.S. SHELF	3/4" PLYWOOD 2 X 6 3/4" PLYWOOD 3/4" PLYWOOD
SALON	114	DOOR STOP	2 X 6
DRYING AREA	115	MASTER BLASTER DRYERS HAND SANITIZER IMPACT DOOR	3/4" PLYWOOD 2 X 6 2 X 6 (SEE DETAIL 6/A6.0)
BATHING AREA	116	SURFACE MOUNTED PIPING & FAUCETS LEASH HOLDERS HYDROSURGE EYEWASH	2 X 6 3/4" PLYWOOD (SEE INT. ELEVATIONS)
RECEIVING	117	IMPACT DOOR CHEMICAL WIPING SYSTEM MOP HOLDER EYEWASH ROOF LADDER	2 X 6 (SEE DETAIL 5/A6.0) 2 X 6 2 X 6 3/4" PLYWOOD 4X (SEE DETAIL 3/A12.0)
ADDITIONS MEET & GREET	118	HAND SANITIZER DOOR STOP	3/4" PLYWOOD
ADDITIONS	119	HAND SANITIZER SOAP DISPENSER PAPER TOWEL DISPENSER IMPACT DOOR CHEMICAL WIPING SYSTEM EYEWASH HAND SANITIZER SOAP DISPENSER DOOR STOP	3/4" PLYWOOD 2 X 6 (SEE DETAIL 6/A6.0) 2 X 6 3/4" PLYWOOD 3/4" PLYWOOD 3/4" PLYWOOD 6005162-33 MTL. STUD
FISH PREP	120	PAPER TOWEL DISPENSER SOAP DISPENSER DOOR STOP	3/4" PLYWOOD 3/4" PLYWOOD 3/4" PLYWOOD
HOLDING ROOM #2	122	HAND SANITIZER SOAP DISPENSER PAPER TOWEL DISPENSER	3/4" PLYWOOD 3/4" PLYWOOD 6005162-33 MTL. STUD
HOLDING ROOM #1	123	HAND SANITIZER SOAP DISPENSER PAPER TOWEL DISPENSER	3/4" PLYWOOD 3/4" PLYWOOD 3/4" PLYWOOD

MILLWORK BLOCKING SCHEDULE: